 
 


## **OSP Bulkhead Feedthrough Cable Jack Rear Mount** Compression Crimp Attachment 1059408-1

408–4594 21 MAR 00 Rev A EC 0990-0362-00


Instruction Sheet






## ASSEMBLY OPERATIONS


1.0 PREPARATION OF CABLE
1.1 TRIM CABLE TO DIMENSION SHOWN.

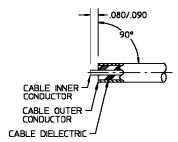

2.0 <u>SHAPE INNER CONDUCTOR OF CABLE</u> 2.1 FILE BLUNT END OF INNER CONDUCTOR TD AN 85°-90° CONE/

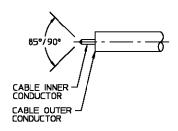

- 3.0 INSTALL CABLE INTO CONNECTOR ASSEMBLY
  3.1 INSTALL LOWER CABLE SUPPORT (FOR .141
  CABLE) AND ANVIL (OSP/F) INTO CRIMP TOOL.
  3.2 SET CRIMP LENGTH ON CRIMP TOOL TO .710
  3.3 CAREFULLY INSERT CABLE INNER CONDUCTOR
  INTO PRE-ASSEMBLED CENTER CONTACT OF
  CONNECTOR ASSEMBLY UNTIL CABLE BOTTOMS
  ON SHOULDER IN CONNECTOR ASSEMBLY.
  3.4 PLACE ASSEMBLY INTO CRIMP TOOL.
  BOTTOMING THE FRONT FACE OF THE CONNECTOR
  AGAINST ANVIL AND ALLOWING THE CABLE TO
  SETTLE IN THE LOWER CABLE SUPPORT.
  3.5 SQUEZE HANDLES OF CRIMP TOOL UNTIL
  RATCHET RELEASES.
  3.6 ASSEMBLY IS NOW COMPLETE.

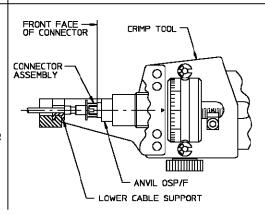

## CABLE TRIM INFORMATION

NOTE 1: DIMENSIONS FROM CONNECTOR REFERENCE PLANE TO WHERE CABLE OUTER CONDUCTOR SEATS .301 ±.010 WHEN ASSEMBLED DIMENSIONS FROM REFERENCE PLANE TO END OF REAR BUSHING .513 ±.010