



The product described in this document has not been fully tested to ensure conformance to the requirements outlined below. Therefore, TE Connectivity (TE) makes no representation or warranty, express or implied, that the product will comply with these requirements. Further, TE may change these requirements based on the results of additional testing and evaluation. Contact TE Engineering for further details.

### MTII JPT MCP SLD 36P Connector

#### 1. SCOPE

##### 1.1. Content

This specification covers the requirements for product performance, test methods and quality assurance provisions of MTII JPT MCP SLD 36P Connector.

##### 1.2. Qualification

When tests are performed on the subject product line, procedures specified shall be used. All inspections shall be performed using the applicable inspection plan and product drawing.

##### 1.3. Qualification Test Results

Successful qualification testing on the subject product line has not been completed. The Qualification Test Report number will be issued upon successful qualification testing.

#### 2. APPLICABLE DOCUMENTS AND FORMS

The following documents and forms constitute a part of this specification to the extent specified herein. Unless otherwise indicated, the latest edition of the document applies.

##### 2.1. TE Documents

- 1743632: Customer Drawing (MTII JPT MCP SLD 36P PLUG)
- 1743636: Customer Drawing (MTII JPT MCP SLD 36P CAP)
- 1743637: Customer Drawing (MTII JPT MCP SLD 36P PLUG COVER)
- 1743693: Customer Drawing (MTII JPT MCP SLD 36P CAP COVER)

#### 3. REQUIREMENTS

##### 3.1. Design and Construction

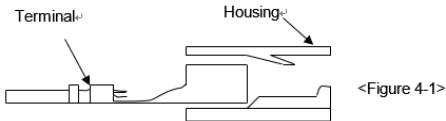
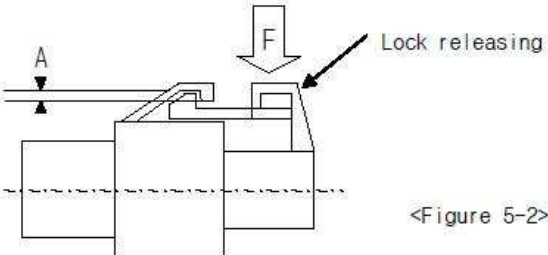
Product shall be of the design, construction, materials and physical dimensions specified on the applicable product drawing.

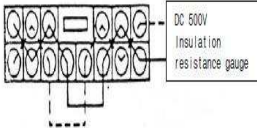
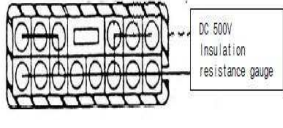
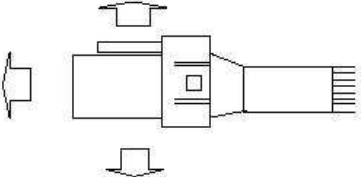
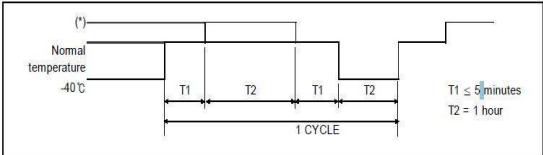
##### 3.2. Ratings

Voltage	Temperature	Humidity
12V DC	25±5°C	60±20%

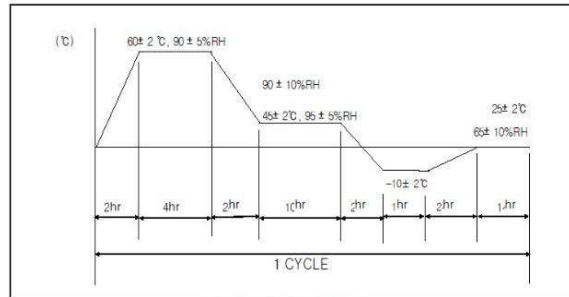
##### 3.3. Test Requirements and Procedures Summary

Unless otherwise specified, all tests shall be performed at ambient environmental conditions.

TEST DESCRIPTION	REQUIREMENT	PROCEDURE
Appearance	No crack, damage, distortion are permitted	Using sense of sight and touch.
CONN engage and disengage force	Max 18 kgf and less	Measure force by inserting and disengaging the connector with terminal assembled at constant 50 mm/min speed. However, remove lock part when measuring disengage force.
Reverse insertion between housings	It shall not be incorrectly inserted by applying force of 20kgf.	Insert the housing with terminal by pushing it in reverse direction with applying 20kgf.
Reverse insertion between terminal and housing	5kgf or more	Crimp cable of maximum size on terminal and then, insert it into housing by the end of insulation.
Engage force between terminal and housing	1.5kgf or less	As shown in the following figure 4-1, measure the weight while inserting terminal into fixed housing at 50mm/min speed. 
Strength of HSG lock	Min 10kgf	Combine housing only, fix the one side of housing in completely locked condition, and extend the other side in axial direction and 30 angle direction at a constant speed of 50mm/min. Then measure weight when lock structure is disengaged or destroyed.
HSG lock releasing force	Max 6kgf	Apply force (F) to lock releasing part, and measure weight on the point of A=0. However, cut connector and then perform test at the section in order to secure visibility. 
Terminal retention force	Min 6kgf	Fix the housing after inserting crimped terminals. Extend one line of cable in axial direction at a speed of 50mm/min at a position 50~100mm away from crimped part, and measure weight when terminal is disengaged from the housing.
Voltage Drop	060: Max 3mV/A 110: Max 3mV/A	Measure the circuit voltage drop (V) by sending voltage and current described in the table 5-1 with terminal combined on the connector. Then calculate a voltage drop (VD) in terminal by subtracting cable resistance (L) from the circuit voltage drop (V).

		<p>1) HARNESS versus UNIT: <math>VD = V(L3+L4)</math></p> <table border="1"> <thead> <tr> <th>Application</th> <th>Open voltage</th> <th>Short circuit current</th> <th>Division</th> </tr> </thead> <tbody> <tr> <td>Signal circuit</td> <td><math>20 \pm 5 \text{ mV}</math></td> <td>10 mA</td> <td>ECU, Sensor</td> </tr> <tr> <td>Power circuit</td> <td>13 V</td> <td>1 A</td> <td>Other than the above</td> </tr> </tbody> </table> <p>&lt;Table5-1&gt;</p>		Application	Open voltage	Short circuit current	Division	Signal circuit	$20 \pm 5 \text{ mV}$	10 mA	ECU, Sensor	Power circuit	13 V	1 A	Other than the above
Application	Open voltage	Short circuit current	Division												
Signal circuit	$20 \pm 5 \text{ mV}$	10 mA	ECU, Sensor												
Power circuit	13 V	1 A	Other than the above												
Insulation resistance	Min 250 MΩ	<p>Measure resistance between neighbor terminals (figure 5-6), and between terminal and housing surface (figure 5-7) with DC 500V insulation resistance gauge with connector combined.</p>   <p>&lt;Figure 5-6&gt; Between neighboring terminals &lt;Figure 5-7&gt; Between neighboring terminal and housing surface</p>													
Leakage current	Max 1 μA	Measure it by applying DC 14V between neighboring terminals													
High voltage test	No allowed insulation breakdown	Measured by applying test potential of 1000 V AC between the adjacent contact between the contact and housing.													
Twisting Test - Connector Engage and Disengage Endurance Test	Appearance	No crack, damage, distortion are permitted	<p>Apply 8kgf force on the end part of combined connector 10 times each in the (front, rear, left, right) directions perpendicular to axial direction.</p> <p>Make combine connectors engage and disengage at 100mm/min. Perform it 50 times. (Do not use locking device)</p>												
	Max 10mV/A														
Cold temperature test	Appearance	No crack, damage, distortion are permitted	<p>Engage and disengage connector with terminal assembled 10 times with hands, and leave it in temperature chamber of -40°C for 120 hours. Make connector engaged and disengaged 5 times immediately, and drop it onto the concrete surface from 1m height 3 times in the direction of figure 6-1. (Voltage drop &amp; Temperature rise test perform at normal temperature) :</p>  <p>&lt;Figure 6-1&gt;</p>												
	Voltage Drop	Max 10mV/A													
	Insulation Resistance	Sealed CONN'R : Min 100 MΩ		Between terminals housing surface											
	Current Leakage	Max 1 μA													
	Temperature Rise	Max 40°C													
Cold and hot temperature shock test	Appearance	No crack, damage, distortion are permitted	<p>Engage and disengage Connector with terminal assembled 10 times with hands, this repeats 200 CYCLE by below test condition. (Sealed : 120°C, Non-Sealed : 80°C)</p> 												
	Voltage Drop	Max 10mV/A													

High temperature test	Appearance	No crack, damage, distortion are permitted		Engage and disengage connector with terminal assembled 10 times with hands, and leave it in combined state at the temperature chamber of the table 6-1 for 300 hours. Then pick it out and leave it until it returns to normal temperature.
	Voltage Drop	Max 10mV/A		
Temperature Humidity Test	Appearance	No crack, damage, distortion are permitted		Engage and disengage connector with terminal assembled 10 times with hands, and leave it at 25°C ambient temperature and 65% relative humidity for 25 hours. And perform 5 cycles of the method specified in figure 6-3
	Voltage Drop	Max 10mV/A		
	Insulation Resistance	Min 100 MΩ	housing surface	
	Current Leakage	Max 1 μA		
Dust Test	Voltage Drop	Max 10mV/A		Engage and disengage connector with terminal assembled 10 times with hands, and diffuse 1.5kg Portland cement(JIS R5210) with fan (or others) for 10 seconds per 15 minutes while maintaining 150mm distance from wall in the closed container of 900~1200mm length, width and height, with connector combined. After 1 hour, measure it.
	Appearance	No crack, damage, distortion are permitted		
Waterproof Test	Insulation Resistance	Min 100 MΩ	housing surface	Make combined connectors engaged and disengaged 10 times with hands, and leave it in combined state at 120 °C ambient temperature for 40 minutes and then spray water of normal temperature for 2 minutes according to S2 of JIS D0203. Repeat 48 cycles of this. * JIS D0203 S2 condition: attach specimen at 400mm distance from the waterproof pipe with water spray hole or water discharge hole and rotate waterproof pipe 23 times per minute around the axis.
	Current Leakage	Max 1 μA		
	Appearance	No crack, damage, distortion are permitted		
Oil and liquid test	Appearance	No crack, damage, distortion are permitted		Engage and disengage connector with terminal assembled 10 times with hands, and perform test each sample with connector combined. A. Immerse connector in combined state for 2 hours in mixed oil of 50± 2°C ENG oil (SAE10W) or equivalent oil and B. Immerse connector in combined state for 1 hour in car gasoline (JIS K2202) at normal temperature, and then pick it out.



&lt; Figure 6-3 : Test pattern &gt;

	Voltage Drop	Max 10mV/A		C. Immerse connector in combined state for 1 hour in brake liquid (pure product) at normal temperature, and then pick it out. D. Immerse connector in combined state for 1 hour in 100% washer liquid (pure product) at normal temperature, and then pick it out. E. Immerse connector in combined state for 1 hour in 50% LLC (Long life coolant) at normal temperature, and then pick it out.
Ozone Test	Appearance	No crack, damage, distortion are permitted		Engage and disengage Connector with terminal assembled 10 times with hands, and samples keep at 40°C and 50±5pphm Ozone for 100hour. Then pick connector out of chamber and dry it for 2hours or more.
	Voltage Drop	Max 10mV/A		
Sulfur (SO <sub>2</sub> ) gas test	Appearance	No crack, damage, distortion are permitted		Engage and disengage connector with terminal assembled 10 times with hands, and expose it in combined state to sulfur gas of 40±3°C, density 10ppm, humidity 90~95%, for 24 hours. Then pick connector out of chamber and dry it for 2 hours or more.
	Voltage Drop	Max 10mV/A		
Salt water test	Appearance	No crack, damage, distortion are permitted		Engage and disengage connector with terminal assembled 10 times with hands, and pout it in 35°C temperature regulation chamber, spray 5% salty water for 24 hours according to JIS Z2371, and, maintain room temperature without spray for 1 hour, Then repeat this four times. Then pick connector out of chamber and dry it at room temperature for 2 hours or more.
	Voltage Drop	Max 10mV/A		
	Insulation Resistance	Min 100 MΩ	Between terminals housing surface	
	Current Leakage	Max 1 μA		
Complex environment endurance test	Appearance	No crack, damage, distortion are permitted		Engage and disengage connector with terminal assembled 10 times with hands, and leave it in combined state in the temperature chamber of 120°C or 80°C (follows table 7) for 48 hours. And then perform the following vibration test. Then measure instant short circuit according to the method of clause 4.16 for 4 hours for X, Y, Z each.
	Crimp Tensile Strength	0.3SQ	Min 6kgf	
		0.75SQ	Min 11kgf	
		0.5SQ	Min 9kgf	
		2.5SQ	Min 25kgf	
		2.5SQ	Min 25kgf	
		4.0SQ	Min 37.5kgf	
	Voltage Drop	Max 10mV/A		
			Division	Condition
			Ambient temperature/humidity	80°C, 90~95%
		Applied current	Basic current (Connector electrodes in series.)	
		Current application cycle	120 CYCLE (45 minutes-ON, 15 minutes-OFF)	
		Vibration acceleration	4.4g	
		Frequency	20Hz ~ 200Hz (sweep time: 3 minutes or less)	
		Vibration time	40 hours for X, Y, Z each	
		Connector attaching method	Test mode A, B, C	

	Temperature Rise	Max 40°C	
	Instant short circuit	Max 10 $\mu$ s	

### 3.4. Applied Part No List

TE Part no	Description
1743632	MTII JPT MCP SLD 36P PLUG
1743636	MTII JPT MCP SLD 36P CAP
1743637	MTII JPT MCP SLD 36P PLUG COVER
1743693	MTII JPT MCP SLD 36P CAP COVER

Rev	Description	Date
A	Released	25.Mar'20
B	Update terminal retention force spec following HKMC spec (ES91500-00 rev 33) min 10kgf → min 6kgf	26.Jan'23